



## Airworthiness Directive

**AD No.:** 2018-0030R1

**Issued:** 04 June 2018

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) 216/2008 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EC) 216/2008, Article 14(4) exemption].

### Design Approval Holder's Name:

DAHER AEROSPACE

### Type/Model designation(s):

TB 9, TB 10, TB 200 aeroplanes

**Effective Date:** Revision 1: 04 June 2018  
Original issue: 14 February 2018

**TCDS Number(s):** EASA.A.378

**Foreign AD:** Not applicable

**Supersedure:** This AD revises AD 2018-0030 dated 31 January 2018, which superseded DGAC France AD 94-264(A) R1 dated 09 October 1996.

## ATA 57 – Wings – Wing Front Attachments – Inspection / Modification / Replacement

### Manufacturer(s):

SOCATA, formerly EADS SOCATA, Société de Construction d'Avions de Tourisme et d'Affaires

### Applicability:

SOCATA TB 9, TB 10 and TB 200 aeroplanes, all manufacturer serial numbers (MSN).

### Definitions:

For the purpose of this AD, the following definitions apply:

**Groups:** Group 1 aeroplanes are TB 9 aeroplanes, all MSN, and TB 10 aeroplanes, MSN 001 to 803 inclusive, 805, 806, 809 to 815 inclusive, and 820 to 822 inclusive. Group 2 aeroplanes are TB 10 aeroplanes, MSN 804, 807, 808, 816 to 819 inclusive, and MSN 823 to 2229 inclusive, and TB 200 aeroplanes, all MSN.

**The SB:** SOCATA Service Bulletin (SB) 10-081-57.

**Inspection:** Dye penetrant inspection or High Frequency Eddy Current inspection.



**Reason:**

During a scheduled maintenance inspection, cracks were found on the wing front attachments of a TB 10 aeroplane.

This condition, if not detected and corrected, could affect the structural integrity of the aeroplane.

Prompted by these findings, SOCATA issued the SB to provide inspection and modification instructions, and DGAC France issued AD 94-264(A), later revised, to require repetitive inspections of wing front attachments of TB 9 and TB 10 aeroplanes (all MSN up to 822 inclusive, with some excluded). That AD also required installation of reinforcement kits, applied as repair (if cracks were found) or as modification (if no cracks were found), of the wing front attachments, on both wing and fuselage sides, and repetitive replacement of those reinforcements afterwards.

Since DGAC France AD 94-264(A) R1 was issued, cracks have been found on wing front attachments, on the wing side, on TB10 aeroplanes to which the AD did not apply, i.e. which were not subject to repetitive inspections as required by that AD. Consequently, SOCATA revised the SB, now at revision (rev.) 3, extending the Applicability to all TB 10 aeroplanes, as well as to TB 200 aeroplanes, and improving the repair solution of the wing front attachment on wing side.

For the reason described above, EASA issued AD 2018-0030, retaining the requirements of DGAC France AD 94-264(A) R1, which was superseded, expanding the Applicability to all MSN for TB 9 and TB 10 aeroplanes and included TB 200 aeroplanes, and requiring an improved repair solution of the wing front attachment on wing side.

Since that AD was issued, it has been determined that the aeroplane configuration definition included in Table 5 was improperly referring to the installation instructions, rather than to the modification kit number. This AD is revised accordingly.

**Required Action(s) and Compliance Time(s):**

Required as indicated, unless accomplished previously:

**Wing front attachments on wing side – Group 1 and Group 2 aeroplanes****Inspection(s):**

- (1) For Group 1 and Group 2 aeroplanes not embodying kit OPT109110XX (see Note 1 of this AD): Within the compliance time as specified in Table 1 of this AD, as applicable, and, thereafter, at intervals not to exceed 2 000 flight hours (FH) or 3 000 landings (LDG), whichever occurs first, accomplish an inspection of the wing front attachments on wing side in accordance with the instructions of the SB at rev. 3.

Note 1: For the purpose of this AD, “XX” can be any numerical value.



Table 1 – Front Wing Attachment, Wing Side, Initial Inspection

Compliance Time (whichever occurs later, A or B)	
<b>A</b>	Before exceeding 2 000 FH or 3 000 LDG, whichever occurs first since aeroplane first flight
<b>B</b>	Group 1 aeroplanes: Within 100 FH after 17 December 1994 [the effective date of the original issue of DGAC France AD 94-264(A)], but not later than 31 October 1995
	Group 2 aeroplanes: Within 13 months after 14 February 2018 [the effective date of the original issue of this AD]

**Corrective Action(s):**

- (2) If, during any inspection as required by paragraph (1) of this AD, any crack is detected, before next flight, reinforce the front attachment on wing side (embodiment of kit OPT10911002) in accordance with the instructions of the SB at rev. 3.

**Modification(s):**

- (3) For Group 1 and Group 2 aeroplanes not embodying kit OPT109110XX (see Note 1 of this AD): Before exceeding the compliance time as specified in Table 2 of this AD, reinforce the front attachment on wing side (embodiment of kit OPT10911002) in accordance with the instructions of the SB at rev. 3.

Table 2 – Front Wing Attachment, Wing Side, Modification Compliance Time

Compliance Time (whichever occurs later, A or B)	
<b>A</b>	Before exceeding 8 000 FH or 12 000 LDG, whichever occurs first since aeroplane first flight
<b>B</b>	Before exceeding 50 FH or 75 LDG, whichever occurs first after 14 February 2018 [the effective date of the original issue of this AD]

**Reinforcement Kit Repetitive Inspection:**

- (4) For Group 1 and Group 2 aeroplanes embodying kit OPT109110XX (see Note 1 of this AD): Before exceeding the compliance time as specified in Table 3 of this AD, and, thereafter, at intervals not to exceed 2 000 FH or 3 000 LDG, whichever occurs first, perform an inspection of the reinforced front attachment on wing side in accordance with the instructions of the SB at rev. 3.

Table 3 – Front Wing Attachment, Wing Side, Reinforcement Kit Initial Inspection

Compliance Time (whichever occurs later, A or B)	
<b>A</b>	Before exceeding 4 000 FH or 6 000 LDG, whichever occurs first after kit OPT109110XX (see Note 1 of this AD) embodiment
<b>B</b>	Before exceeding 50 FH or 75 LDG, whichever occurs first after 14 February 2018 [the effective date of the original issue of this AD]



- (5) Replacing kit OPT109110XX with kit OPT10911002 on an aeroplane, at intervals not to exceed 4 000 FH or 6 000 LDG, whichever occurs first, in accordance with the instructions of the SB at rev. 3, is acceptable to comply with the requirements of paragraph (4) of this AD for that aeroplane.

**Corrective Action(s):**

- (6) If, during any inspection as required by paragraph (4) of this AD, any crack is detected, before next flight, replace the reinforced front attachment on wing side in accordance with the instructions of the SB at rev. 3.

**Terminating Action(s):**

- (7) Accomplishment of corrective actions on an aeroplane as required by paragraph (6) of this AD does not constitute terminating action for the repetitive inspections as required by paragraph (4) of this AD for that aeroplane.

**Credit:**

- (8) Inspections and corrective actions, accomplished on an aeroplane before 14 February 2018 [the effective date of the original issue of this AD], in accordance with the instructions of the SB at original issue, or Revision 1, or Revision 2, are acceptable to comply with the initial requirements of paragraphs (1), (2), (3), (4), (5) and (6) of this AD, as applicable, for that aeroplane.

**Wing front attachments on fuselage side – Group 1 aeroplanes**

**Inspection(s):**

- (9) For Group 1 aeroplanes: Within the compliance time as specified in Table 4 of this AD, and, thereafter, at intervals not to exceed 2 000 FH or 3 000 LDG, whichever occurs first, accomplish an inspection of the wing front attachments on fuselage side in accordance with the instructions of the SB.

Table 4 – Front Wing Attachment, Fuselage Side, Initial Inspection

<b>Compliance Time (whichever occurs later, A or B)</b>	
<b>A</b>	Before exceeding 2 000 FH or 3 000 LDG, whichever occurs first since aeroplane first flight
<b>B</b>	Within 100 FH after 17 December 1994 [the effective date of the original issue of DGAC France AD 94-264(A)], but not later than 31 October 1995

**Corrective Action(s):**

- (10) If, during any inspection as required by paragraph (9) of this AD, any crack is detected, before next flight, accomplish the applicable corrective action(s) in accordance with the instructions of the SB.

**Modification(s):**

- (11) For Group 1 aeroplanes: Unless already accomplished as required by paragraph (10) of this AD, within the compliance time as specified in Table 5 of this AD, as applicable, reinforce the front attachment on fuselage side in accordance with the instructions of the SB.



Table 5 – Modification

Aeroplane(s)	MSN and Configuration	Compliance Time
TB 9 and TB 10	MSN 001 to 399 inclusive, and 413, except those that have SOCATA kit OPT10908100 embodied	Before exceeding 4 000 FH or 6 000 LDG, whichever occurs first since aeroplane first flight
	MSN 001 to 399 inclusive, and 413, with SOCATA kit OPT10908100 embodied	Before exceeding 8 000 FH or 12 000 LDG, whichever occurs first since aeroplane first flight
TB 9	MSN 400 to 412 inclusive, and 414 to 2229 inclusive	
TB 10	MSN 400 to 412 inclusive, 414 to 803 inclusive, 805, 806, 809 to 815 inclusive and 820 to 822 inclusive	

**Reinforcement Kit Repetitive Replacement:**

(12) For Group 1 aeroplanes: Within 8 000 FH or 12 000 LDG, whichever occurs first after accomplishment of the actions as required by paragraph (10) or (11) of this AD, as applicable, and, thereafter, at intervals not to exceed 8 000 FH or 12 000 LDG, whichever occurs first, replace the reinforced front attachment on fuselage side in accordance with the instructions of the SB.

**Terminating Action(s):**

(13) Accomplishment of corrective actions on an aeroplane, as required by paragraph (10) of this AD, as applicable, or modification of an aeroplane, as required by paragraph (11) of this AD, as applicable, does not constitute terminating action of the repetitive inspections required by paragraph (9) of this AD, as applicable, for that aeroplane.

**Ref. Publications:**

SOCATA SB 10-081-57 original issue dated October 1994, or rev. 1 dated August 1996, or rev. 2 dated January 2017, or rev. 3 dated December 2017.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.

**Remarks:**

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. The original issue of this AD was posted on 10 March 2017 as PAD 17-029 for consultation until 07 April 2017. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu).



4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#).
5. For any any question concerning the technical content of the requirements in this AD, please contact:  
DAHER AEROSPACE, Direction des services, 65921 Tarbes Cedex 9, France,  
Telephone +33 (0) 5 62 41 73 00, Fax + 33 (0) 5 62 41 76 54

or for the U.S.A.:

DAHER AIRCRAFT INC, 601 NE 10 Street, Pompano Beach, Florida 33060,  
United States of America,  
Telephone +1 (954) -366-3331.

