

Occurrence Communication: Oc00172-2019 **Date:** 17/May/2019

Page 1 of 1

Type: /

Aircraft: EMB-120	Model: EMB-120 ER	Serial Number: 120307
Marks: N233SW	Operator: BERRY AVIATION	Occurrence Date: 24/Jul/2018
Ata: 30	Time:	Number of Persons Aboard: Not Available
Aircraft Damages:		
Site: NOT AVAILABLE		
Injuries: <input checked="" type="checkbox"/> None Light: 0 Serious: 0 Fatal: 0		

Occurrence Description:

Report of smoke in the cockpit.
The flight crew reported odor similar to burning wire and smoke was noticed. De-ice light indication fail illuminated and Nr 2 PITOT static circuit breaker popped.
Maintenance personnel found the power feed wires for the pitot nr 2 tube heater relay burnt out, also relays and relay sockets K0092, K0093, K0092, Kx0093. Removed and replaced nr 2 pitot tube heat circuit breaker CB0234, current sensors T0030 and T0031, the damaged wiring at relays.